

SB: Wall mounted hose boxes rollup 15, 25, 35 and 35Li

Article : 8022, 8023, 8024 and 8025



Reason: Several improvements on the products since production start.

Issues on article 8022:

- Deformed wall holders caused by influence of heat: the box housings were reinforced since index "D343"




- Gaps between the half housings: additional screw bore was implemented since index "D343"
- Internal leakage: The o-ring grooves of the axle and the water connector were modified since index "D344 ". In cases of repairs always exchange both parts !

- Kinks in the connecting hose: the card boxes were slightly increased to prevent the hose from kinking.

Issues on articles 8023, 8024 and 8025:

- Transport damages on wall holders: The wall holder will get 4 additional stoppers. The new version will be available in spring 2014

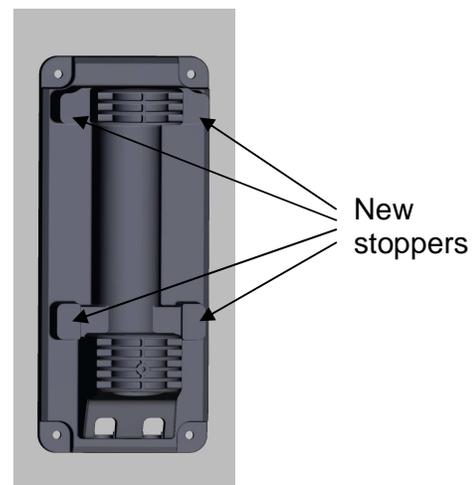

- Transport damages of the water flange : the palletisation was optimized since "C334"
- Internal leakage: The o-ring grooves of the axle and the water connector were modified since index "D344" . In cases of repairs always exchange both parts!

- Gaps between the half housing: This failure was caused in the production and was eliminated by more accurateness on the assembling process.

Issue only on article 8025:

- Electronic malfunction: The keypad is protected with protective lacquer against humidity
- Software update to reduce the roll up speed, implemented with index A302